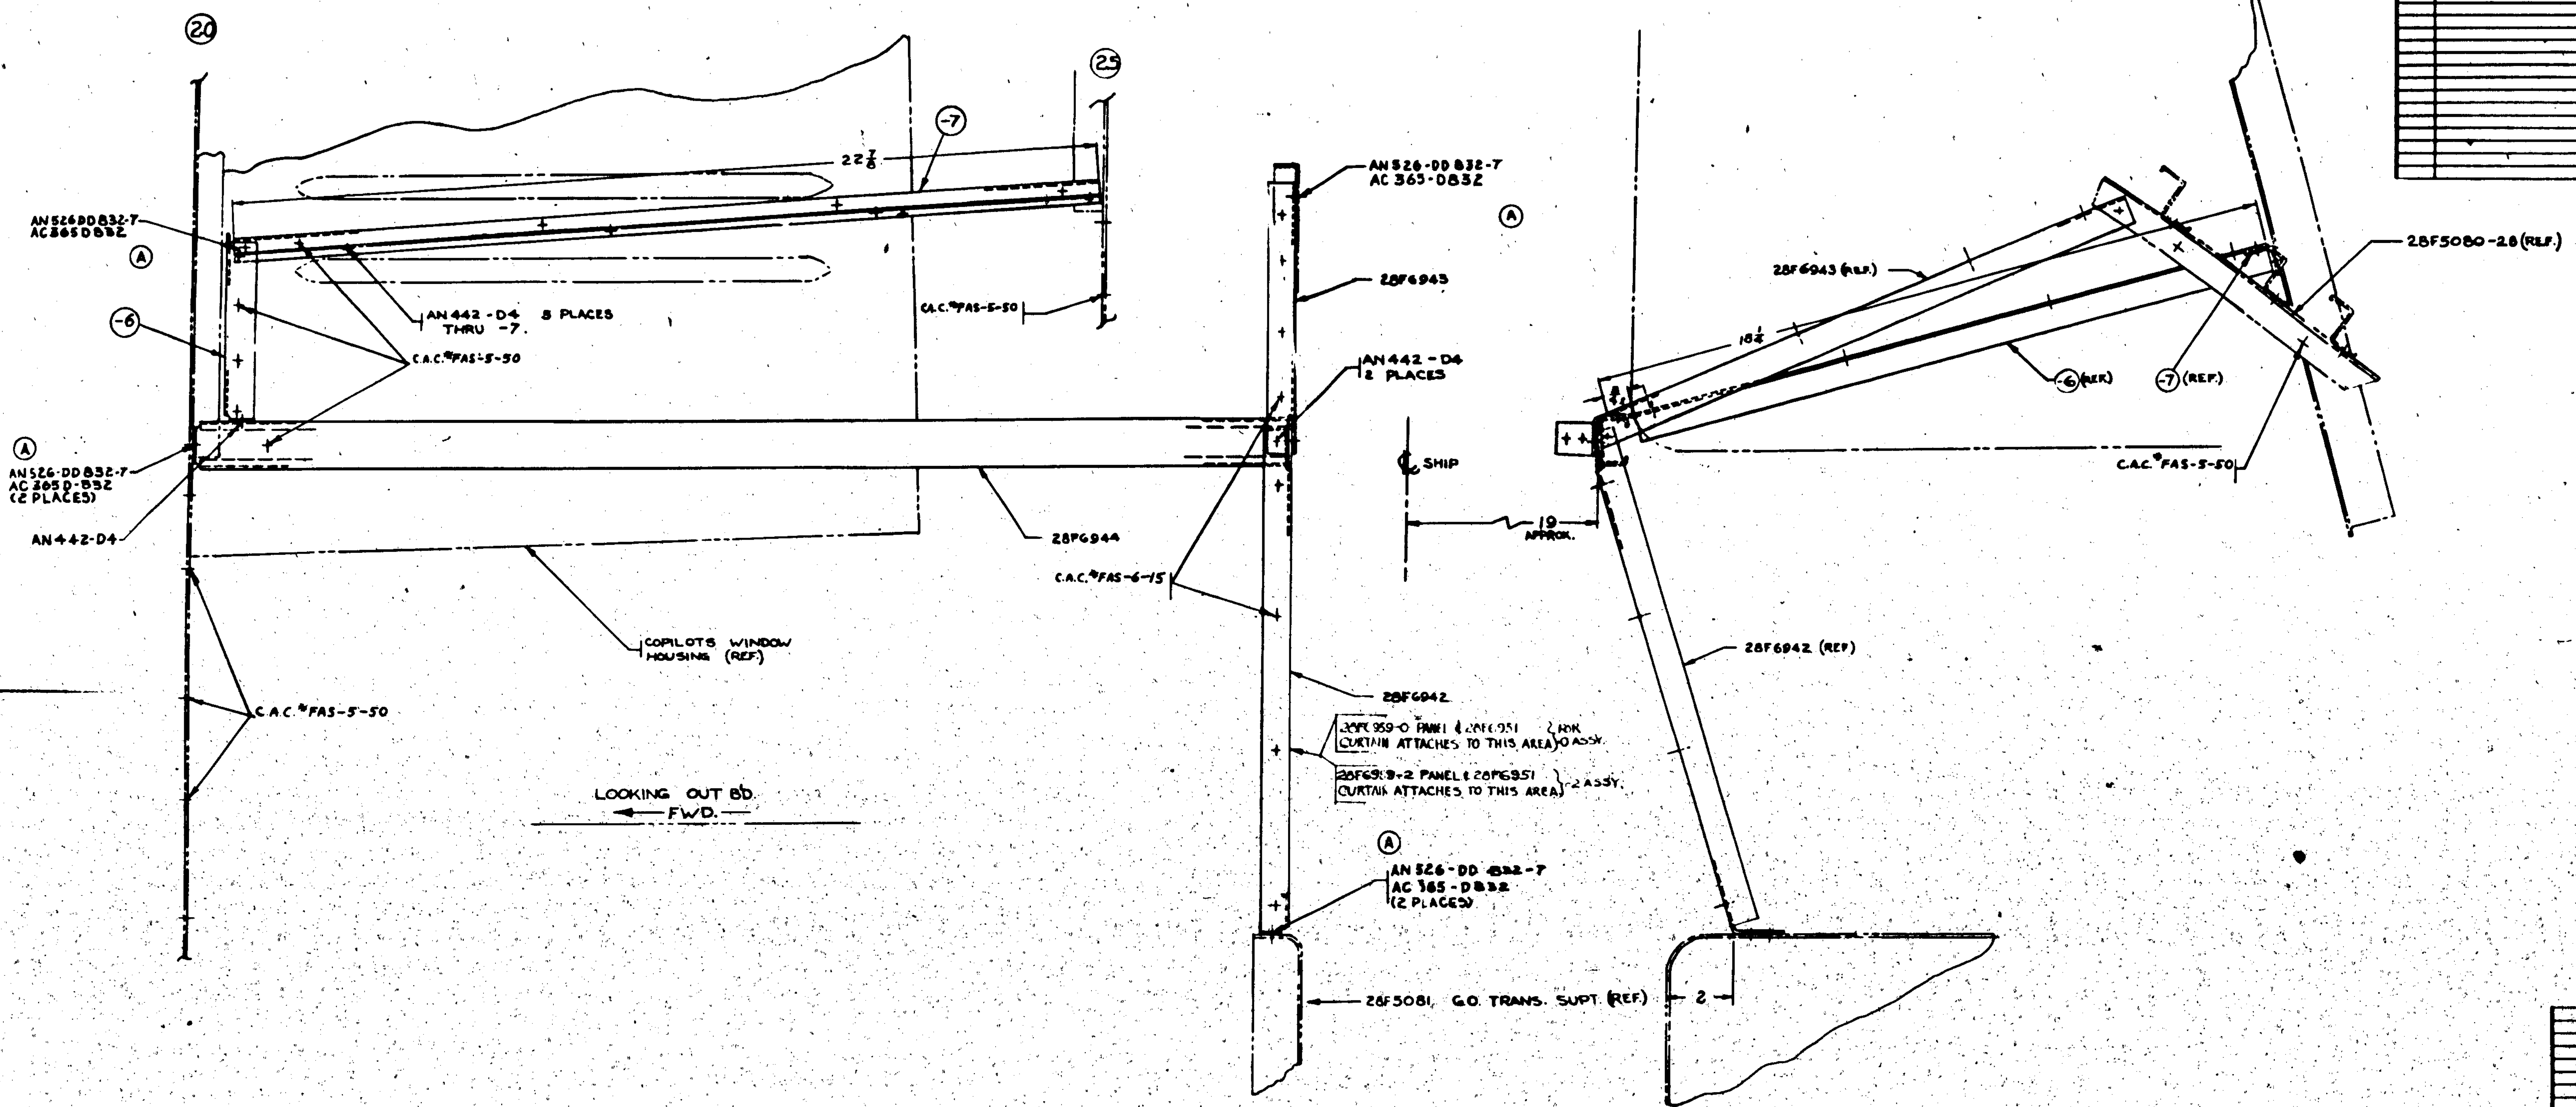


LET	ALTERATION	DATE	BY
A	ON FACE OF DWG. AN526-DD832-7 (6 PLACES) & AC365-D832 (6 PLACES) WAS AN442-D4. ADD TO P.L. AN526-DD832-7 (6) & AC365-D832 (6) WAS (...)		E.O.
B	CREATED -2 ASSY SAME AS -0 ASSY EXCEPT THAT 28F6959-2 REPLACES 28F6959-0 PNL. -2 REPLACES -0		

PART NO.	STOCK	MATERIAL	SPEC.	-0	-2	-3	-4	-5
AN442-D4								
AN526-DD832-7				6	6			
AC365D832				6	6			
CAC #FAS-6-15 #17303 x 1/2 STUD				7	7			
CAC #FAS-5-50 #17302 x 1/2 STUD				56	54			
MAY BE PURCHASED FROM UNITED CARR FAST. CORP. CAMBRIDGE MASS.								
28F6959-2					1			
28F6959-0 CURTAIN PANEL				1				
28F6951 CURTAIN				1	1			
28F6944				1	1			
28F6943				1	1			
28F6942				1	1			
-7	Y2A24ST x 23 3/8			1	1			
-6	Y2A24ST x 19 1/2			1	1			

PARTS LIST PER ASSY.

NOTE:
LOCATION OF FASTENER'S TO BE DETERMINED ON FIRST INSTALLATION.

ASSY. DASH NO.	MODEL	NEXT ASSY.	NO.
-2	PBY-5A	28F6002	1
-2	PBY-5	28F1002	1
-0	PBY-5A	28F6002	1
-0	PBY-5	28F1002	1

REQUIREMENTS PER AIRPLANE

REPLACES: | .772 |
REPLACED BY:

LIMIT IN DIMENSION UNLESS OTHERWISE SPECIFIED: ± 1/32 | SCALE 6" = 1' 0"

STAMP PART NUMBER WHERE SHOWN

FINISH: ZP-GP
DATE: 9/11/42

NAME: INST. - FURN - RADAR OPERATOR'S CURTAIN SUPP.

CONSOLIDATED AIRCRAFT CORP. SAN DIEGO, CALIF.

SUPERSEDES: NONE

SIZE J | 28F6945

140 (2)

H 405

28F6945 R 10/18/42